

UT123

Residential Multimeter

User manual

Preface

Thank you for purchasing the new UT123 residential multimeter. In order to use this product safely and correctly, please read this manual thoroughly, especially the *Safety Instructions*.

After reading this manual, it is recommended to keep the manual at an easily accessible place, preferably close to the device, for future reference.

Limited Warranty and Liability

Uni-Trend guarantees that the product is free from any defect in material and workmanship within one year from the purchase date. This warranty does not apply to damages caused by accident, negligence, misuse, modification, contamination and improper handling. The dealer shall not be entitled to give any other warranty on behalf of Uni-Trend. If you need warranty service within the warranty period, please contact your seller directly.

Uni-Trend will not be responsible for any special, indirect, incidental or subsequent damage or loss caused by using this device. As some countries or regions do not allow limitations on implied warranties and incidental or subsequent damages, the above limitation of liability may not apply to you.

1. Overview

The UT123 is a pocket-size residential multimeter specially designed for home use. The compact structure makes it easy to hold in one hand, and the EBTN screen allows users to obtain clear readings at maximum angle. The multimeter is designed according to EN61010-1:2010, EN61010-2-030:2010, and EN61326-1:2013 safety standards and is able to safely operate within the CAT III 600V environment.

2. Features

- The battery status detection is automatically completed at the moment of booting: The green light indicates the normal state; the yellow light indicates low battery; the red light indicates very low battery, and there is acousto-optic indication at this time.
- Automatic identification of ACV/DCV measurement
- Intelligent non-contact electric field detection, which distinguishes the weak electric field by green light, the strong electric field by yellow light, and the super strong electric field by red light
- Full featured protection

▲ Before using the meter, please read the *Safety Instructions* carefully.

3. Safety Instructions

- Do not use the meter if the rear cover is not covered up, or it will pose a shock hazard!
- Before use, please check and make sure the insulation layer of the meter and test leads is in good condition without any damage or broken wires. If you find the insulation layer of the meter housing is significantly damaged, or if you think the meter cannot function properly, do not use the meter.
- When using the meter, your fingers must be placed behind the finger guard ring of the test leads.
- Do not apply voltage over 600V between any meter terminal and earth ground to prevent electric shock and damage to the meter.
- Be cautious when the measured voltage is higher than 60V (DC) or 30Vrms (AC) to avoid electric shock!
- The measured signal is not allowed to exceed the specified limit to prevent electric shock and damage to the meter!
- The range switch should be placed in the corresponding position during measurement.
- Never change the range setting when measuring to avoid damage to the meter!
- Do not change the internal circuit of the meter to avoid damage to the meter and user!
- When the "OL" symbol appears on the LCD, please replace the batteries in time to ensure measurement accuracy.
- Do not use or store the meter in high temperature and high humidity environments. The performance of the meter may be affected.
- Clean the meter casing with a damp cloth and mild detergent. Do not use abrasives or solvents!
- Safety symbol description

	Low battery		High voltage hazard
	Grounding		AC voltage or current
	Double insulated		DC voltage or current
	Warning		

4. Operating Instructions


* The meter has the function of battery self-checking, and can complete the battery status detection within 2 seconds at the moment of booting:

- When the supply voltage is $>2.7V$, the indicator on the top of the meter lights up green for 2 seconds, indicating that the power is sufficient, and the meter enters the normal measurement mode accompanied by one beep.
- When the supply voltage is within $2.4V\sim 2.7V$, the indicator on the top of the meter lights up yellow, and the low battery symbol "" appears on the LCD.
- When the supply voltage is $<2.4V$, the indicator on the top of the meter lights up red for 2 seconds, and then the meter powers off. It can only be used after replacing the batteries.

4.1 DC/AC Voltage Measurement (Picture 1)

- Turn the range switch to the AC voltage position;
- Insert the red test lead into the " $V\Omega\text{-}\mu\text{C}$ " jack, black into the "COM" jack, and make the probes in contact with both ends of the measured voltage (parallel connection to the load);
- Read the test results on the display.

The meter has the function of ACV/DCV automatic identification (voltage $\geq 0.5V$). If you want to measure voltage less than $0.5V$, press the SELECT button to toggle the AC and DC voltage to lock the measurement mode; After pressing the SELECT button, the meter no longer has the function of ACV/DCV automatic identification, unless you turn the range switch or restart the meter!

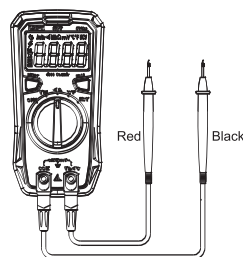

Picture 1

▲ Note:

- Do not measure voltage above 600Vrms. Although it is possible to measure higher voltage, it may damage the meter and hurt the user! If the LCD displays "OL", it indicates that the voltage is over range. The input impedance of the meter is $10M\Omega$. This load effect may cause measurement error when measuring high impedance circuits. If the measured impedance is $\leq 10k\Omega$, the error can be ignored ($\leq 0.1\%$).
- Be cautious to avoid electric shock when measuring high voltage.
- Test known voltage before use to confirm if the meter functions properly!

4.2 Resistance Measurement (Picture 1)

- Turn the range switch to the resistance measurement position;
- Insert the red test lead into the " $V\Omega\text{-}\mu\text{C}$ " jack, black into the "COM" jack, and make the probes in contact with both ends of the measured resistance (parallel connection to the resistance);
- Read the test results on the display.

▲ Note:

- Before measuring the online resistance, switch off the power supply of the circuit, and fully discharge all capacitors to avoid damage to the meter and user.
- If the resistance is not less than 0.5Ω when the test leads are shorted, please check if the test leads are loose or abnormal.
- If the measured resistor is open or the resistance exceeds the maximum range, the "OL" symbol will appear on the display.
- Do not input voltage higher than DC 60V or AC 30V.
- Measured value = measured display value - short circuit value of the test leads

4.3 Continuity Measurement (Picture 1)

- Turn the range switch to the continuity measurement position;
- Insert the red test lead into the " $V\Omega\text{-}\mu\text{C}$ " jack, black into the "COM" jack, and make the probes in contact with the two test points;
- Measured resistance $\leq 30\Omega$: The indicator lights up green accompanied by continuous beeps, indicating that the on-resistance is small, and the LCD displays the corresponding resistance value.
Measured resistance within $31\Omega\sim 420\Omega$: The indicator lights up red accompanied by no beep, indicating that the on-resistance is large, and the LCD displays the corresponding resistance value.
Measured resistance $>420\Omega$: The indicator and buzzer have no response, indicating that the circuit is open. The LCD displays "OL".

▲ Note:


- Before measuring the continuity online, switch off the power supply of the circuit, and fully discharge all capacitors to avoid damage to the meter and user.

4.4 Temperature Measurement ($^{\circ}C/^{\circ}F$ Measurement, Picture 2)

- Turn the range switch to the temperature measurement position;
- Insert the plug of the K-type thermocouple into the meter, and fix the temperature sensing probe on the object to be tested; read the temperature value on the display after it is steady.

▲ Note:


- "OL" symbol appears when the meter is turned on. Only K-type thermocouple/ temperature sensor is applicable (The measured temperature should be less than $300^{\circ}C/572^{\circ}F$).
- $^{\circ}F = ^{\circ}C \times 1.8 + 32$

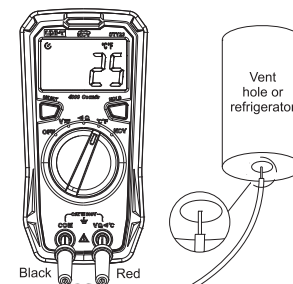

Picture 2

4.5 Non-contact AC Electric Field Sensing (Picture 3)

- To sense whether there is AC voltage or electromagnetic field, please turn the range switch to the NCV position;
- Bring the front end of the meter close to the measured object to start sensing. The intensity of the electric field sensing is indicated by the LED indicator and the segment "-" on the LCD. The more the segments (up to four segments) are displayed, the higher the electric field intensity and the faster the beep.

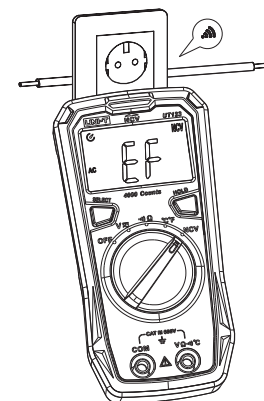

Picture 3

4.6 Others

- During measurement, if there is no operation of the range switch or any button for 15 minutes, the meter will automatically shut down to save power. You can wake it up by pressing any button or turning the range switch, and the buzzer should beep once for indication. To disable auto shutdown, turn the range switch to the OFF position, press and hold the SELECT button (≥ 2 seconds) while power up the meter.
- When you press any button or turn the range switch, the buzzer will beep once.
- Buzzer warning:
Input voltage $\geq 600V$ (AC/DC): The buzzer beeps continuously warning that the range is at its limit.
- About 1 minute before auto shutdown, the buzzer will make five consecutive beeps; before shutdown, the buzzer will make one long beep.

5. Specifications

Function	Range	Resolution	Accuracy	Max measured value	Bandwidth	Overload protection	Input impedance
DC voltage	4.000V	0.001V	$\pm (0.5\%+2)$	$\pm 600V$		600Vrms	10M Ω
	40.00V	0.01V					
	400.0V	0.1V					
	600V	1V	$\pm (0.7\%+3)$				
AC voltage	4.000V	0.001V	$\pm (1.0\%+3)$	600V	40Hz—400Hz	600Vrms	10M Ω
	40.00V	0.01V					
	400.0V	0.1V					
	600V	1V					
Resistance	400.0 Ω	0.1 Ω	$\pm (1.0\%+2)$	21M Ω		600Vrms	
	4.000k Ω	0.001k Ω	$\pm (0.8\%+2)$				
	40.00k Ω	0.01k Ω					
	400.0k Ω	0.1k Ω					
	4.000M Ω	0.001M Ω	$\pm (1.2\%+3)$				
20.00M Ω	0.01M Ω	$\pm (1.2\%+3)$					
Centigrade	-40~40 $^{\circ}C$	1 $^{\circ}C$	$\pm 4^{\circ}C$	350 $^{\circ}C$		600Vrms	
	40~300 $^{\circ}C$	1 $^{\circ}C$	$\pm (1.0\%+5)$				
Fahrenheit	-40~104 $^{\circ}F$	1 $^{\circ}F$	$\pm 6^{\circ}F$	662 $^{\circ}F$		600Vrms	
	104~572 $^{\circ}F$	1 $^{\circ}F$	$\pm (2.0\%+6)$				

When switching to the NCV function, the LCD displays "EF"

NCV (non-contact voltage detection)	Electric field sensing	When the front end of the meter is close to the power socket or power cord with about 200V mains supply, the meter indicator will distinguish the intensity of the electric field sensing by "green", "yellow" and "red" light respectively (from weak to strong), and the LCD will synchronously display "—", "—", "—" or "—" accompanied by beeps.
	Neutral and live wire identification	When the front end of the meter is close to the mains socket at the same distance, the live wire will have a stronger electric field signal than the neutral wire. You can distinguish them according to the number of the "—" displayed and the indication status of the light.
••) Continuity	Resistance $\leq 30\Omega$, continuous beeps; Resistance $> 31\Omega$, no beep	

General specifications

SELECT button	Switch the scale of the test function cyclically (only applicable to V_{AC} , Ω and $^{\circ}C/^{\circ}F$).
HOLD button	Turn on/off the lock screen function cyclically, and the bottom left corner of the LCD displays "H" (only applicable to V_{AC} , Ω and $^{\circ}C/^{\circ}F$).
Max display	4099
Overload display	OL
Sampling frequency	3 times/second
Polarity display	If negative polarity is input, the "-" symbol will be displayed; No display for positive polarity
Low battery indication	The bottom left corner of the LCD displays "L", and at the moment of booting, the indicator on the top of the meter lights up yellow.

Operating conditions

Operating temperature	0 $^{\circ}C$ ~40 $^{\circ}C$ (32 $^{\circ}F$ ~104 $^{\circ}F$)
Storage temperature	-10 $^{\circ}C$ ~50 $^{\circ}C$ (14 $^{\circ}F$ ~122 $^{\circ}F$)
Relative humidity	0 $^{\circ}C$ ~ below 30 $^{\circ}C$: $\leq 75\%$ 30 $^{\circ}C$ ~40 $^{\circ}C$: $\leq 50\%$
Altitude	0~2000m
Battery	AAA battery 1.5V \times 2

Safety standards

Design standards	EN61010-1: 2010; EN61010-2-030:2010; EN 61326-1:2013
EMC	RF field (1V/m): Overall accuracy = specified accuracy $\pm 5\%$ of range RF field ($>1V/m$): No specified calculation
Measurement standards	CAT III 600V, double insulation and material pollution degree II
Dimensions	130mm \times 65mm \times 28mm
Weight	About 130g (including batteries)

Standard accessories

Test leads	1 pair
User manual	1 pc
Thermocouple	1 pc


⚠ Note:
To ensure measurement accuracy, operating temperature should be within 18 $^{\circ}C$ ~28 $^{\circ}C$ and the fluctuation range should be within $\pm 1^{\circ}C$.
Temperature $<18^{\circ}C$ or $>28^{\circ}C$: Add temperature coefficient error 0.1 x (specified accuracy)/ $^{\circ}C$.

6. Maintenance

⚠ Warning: Before opening the rear cover of the meter, switch off the power supply (remove the test leads from the input terminals and the circuit).

6.1 General Maintenance

- * Clean the meter casing with a damp cloth and mild detergent. Do not use abrasives or solvents!
- * If there is any malfunction, stop using the meter and send it for maintenance.
- * The maintenance and service must be implemented by qualified professionals or designated departments.

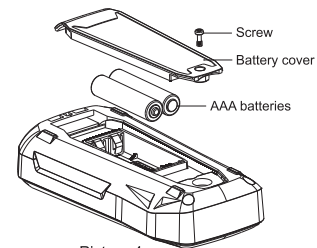

Picture 4

6.2 Battery Replacement (Picture 4)

- * Replace the batteries immediately when the low battery symbol "L" appears on the LCD, otherwise the measurement accuracy might be affected. Battery specification: AAA battery 1.5V \times 2
- * Battery replacement: Use a screwdriver to unscrew the screw on the battery cover (top), and remove the cover to replace the batteries. Pay attention to the positive and negative polarity when installing the new batteries.

UNI-T
UNI-TREND TECHNOLOGY (CHINA) CO., LTD.

No. 6, Gong Ye Bei 1st Road,
Songshan Lake National High-Tech Industrial
Development Zone, Dongguan City,
Guangdong Province, China
Tel: (86-769) 8572 3888
www.uni-trend.com

彩盒 菲林做货要求：

序号	项目	内容	备注	
1	尺寸	展开:210*285mm 折后: 105*95mm		
2	材质	60g书纸		
3	颜色	单色		
4	外观要求	完整清晰、版面整洁，无斑墨、残损、毛边、刀线错位等缺陷。		
5	装订方式			
6	表面处理			
7	其它	无		
版本		REV. 0		
DWH 设计	宣浩	MODEL 机型: Ut123		Part NO. P/N:110401108394X 物料编号:
CHK 审核		 优利德科技(中国)有限公司 UNI-TREND TECHNOLOGY (CHINA) LIMITED		
APPRO. 批准				